

there are no more Dynamo cushions



Top – Dynamo Rail - Bottom – Valley 5-bolt rail

The “three bolts that matter” to the Dynamo owner are in the correct places on a Valley rail set.

WORST CASE : for Dynamo tables more than 25 years old (typically those with weighted cue ball separators) **it may be necessary to shave or sand 1/8” from the bottom of the cushion wood so the rails will mount low enough.**

There is no “high hole” or “low hole” placement for Dynamo rails. The wood changed.

We have created a Dynamo Fit Gauge we will send you free of charge. You can use this on your table with an existing rail bolt to see if the current-style rails work on your Dynamo table without modifications. Send your address to parts@valley-dynamo.com to request a free fit gauge.

If you get a fit gauge, check your table, order the correct-size rails and they don’t mount correctly – we will refund your price in full with no restocking fee.

If you do not get the gauge, order rails and they do not mount correctly, a restocking fee will be charged.

Look directly to the left inside your Dynamo table’s Ball View Door opening.




WEIGHTED:
Note 90-degree
bend in ball path

Tables built prior to 1993 used a weighted cue ball and the separator (which has moving parts) looks like the photo on the left.

Tables built since 1995 use a magnetic cue ball. If you see something like this shot of the separator to the RIGHT, you’ve

likely got magnetic separation.

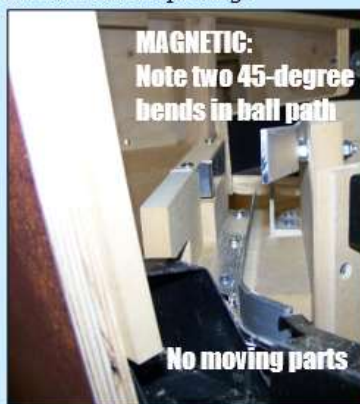

MAGNETIC:
Note two 45-degree
bends in ball path

No moving parts

If you’re unsure that this may need done, and don’t take our advice to get a free Fit Gauge – we recommend ordering UNCOVERED rails so there’s no need to remove the cloth to shave or sand the wood.

There are no plans to EVER AGAIN stock Dynamo-only rails.

Not when Valley rails fit the last 25 years of Dynamo table production.